

 VEHICLE DESCRIPTION - Audi A1 Advanced 1.0 30 TFSI



|                                               |                                      |
|-----------------------------------------------|--------------------------------------|
| <b>First registration date</b><br>5/2023      | <b>VIN:</b><br>WAUZZZGB7PR054696     |
| <b>Colour:</b><br>Black Metallic Normal gloss | <b>Mileage (km):</b><br>20.987       |
| <b>Gear:</b><br>Manual (6 Gears)              | <b>Fuel type:</b><br>Gasoline        |
| <b>Body type:</b><br>Hatchback                | <b>Number of doors:</b><br>5         |
| <b>Drive type:</b><br>FWD                     | <b>Model year:</b><br>2018           |
| <b>Engine power:</b><br>81 kW                 | <b>Number of seats:</b><br>5         |
| <b>Engine size (cc)</b><br>999                | <b>Interior:</b><br>Dark grey Fabric |

 VEHICLE DETAILS

|                                       |                                             |                                                        |                                      |
|---------------------------------------|---------------------------------------------|--------------------------------------------------------|--------------------------------------|
| <b>Number of keys:</b><br>2           | <b>Number of license plates:</b><br>2       | <b>Registration certificate:</b><br>Part 1 & 2 present | <b>Service documentation:</b><br>Yes |
| <b>Inspection date:</b><br>27-07-2026 | <b>Last service (year/month):</b><br>2025/2 | <b>Mileage (km) at last service:</b><br>16.266         |                                      |

 SUMMARY OF THE VEHICLE'S CONDITION

|                                                    |                                                  |
|----------------------------------------------------|--------------------------------------------------|
| <b>Is the car in a driveable condition:</b><br>Yes | <b>Legal tire tread (minimum 1.6 mm):</b><br>Yes |
|----------------------------------------------------|--------------------------------------------------|

WHEELS

|  TYPE | SEASON       | BRAND | POSITION    | RIM       | SIZE | TREAD |
|---------------------------------------------------------------------------------------|--------------|-------|-------------|-----------|------|-------|
| Fitted                                                                                | Summer tires |       | Front Left  | Alloy rim | 16"  | 6 mm  |
| Fitted                                                                                | Summer tires |       | Rear Right  | Alloy rim | 16"  | 6 mm  |
| Fitted                                                                                | Summer tires |       | Rear Left   | Alloy rim | 16"  | 6 mm  |
| Fitted                                                                                | Summer tires |       | Front Right | Alloy rim | 16"  | 6 mm  |


Legal tire tread (minimum 1.6 mm):

Yes

ACCESSORIES

Rear overhang- short, 5 doors, Front stabilizer bar, Wheelbase, Standard, Installation differentiation for transmission MQ 200\_GA -- vehicle components --, SEAT manufacturing sequence, Without alternative drive system, With special labels safety certificates for Denmark, Standard rear axle, Floor mats- front, Accent surfaces- Black, Manual in Danish, Standard climatic zones, Weight range 8 installation control only- no requirement forecast, Fuel system for fuel-injected SI engine (tropicalized), Electronic Stabilization Control ESC, Without trailer hitch, Activated carbon canister (Evaporative Emission Control System (EVAP)), Special identification label (EU), Tire repair kit, Seat occupancy sensor, Standard suspension, Disk brakes- rear- 14-inch, Standard air cleaner, Standard wheel bolts, Vehicle tool kit, Without additional front underbody guard, First-aid kit with warning triangle, Vehicle class differentiation -GB0/GBS-, Without refrigerator/glove compartment cooling system, Front-wheel drive, Leather steering wheel- 3-spoke with multifunction plus, Electronic differential lock XDS- dynamic traction support, Initial standard fuel filling, Disk brakes- front- 15-inch, Safety steering column, Without "drive select", Bumpers- advanced, Labels in English and German, Standard design, Without additional tires, Model name as per new output designation, License plate carrier in front and rear (ECE), i-Size child seat mounting on the front passenger side and i-Size and top tether on the outer rear seats, Without roof insert (standard roof), Without child seat anchora in front (ISOFIX), Without luggage/load compartment floor, Without backrest release for front seats, Front passenger seat- height-adjustable, Rear seat backrest- folding, Head restraints- rear, 3-point seat belts in front- with tensioner and height adjustment, 3-point seat belts on outer rear seats with ECE labels with pretensioners for EU28, Seat heating- front, Emission standard EU6 AP, Windshield with heat-insulating glass, Remote control key- without Safelock, Rear and side windows with heat-insulating glazing, Interior mirror- automatically dimming, Rear floor panel module- type 1, Window controls, Airbags- front, front passenger airbag can be deactivated, Side airbags- front and head airbag system, Trim strips- Black, Carrier frequency 433.92 MHz-434.42 Mhz, Standard rear spoiler, Decals ROW, Inlays- Polygon Structure- Black, Exterior mirrors on the right- (large field of view)- convex, Left exterior mirror- aspherical, Head restraints- front, Without fire extinguisher, Comfort center armrest- front, Without decorative films/emblems, Exterior mirror housings in body color, Roof dome in body color, Lane departure warning, Audi pre sense front for adaptive cruise control, Headlining in cloth in specific color, Hand brake lever handle in leather, Exterior mirrors- electrically adjustable and heated, Electronic immobilizer, Without heat accumulator/auxiliary heater, Gearshift/selector lever handle, Without leather, Tire pressure loss indicator, Start-stop system with recuperation, Door sill trims with aluminum inlays- front, Without lumbar support in seat backrests, Without navigation device, Without extended safety system, Without park distance control, Without lane change assist, Without second battery, Without light control, Alternator 140 A, Headlamps, Separate daytime running light, Rear window wiper and washer system with intermittent control, Light/rain sensor, Headlight range control, Key for locking system, 6 loudspeakers, Automatic distance control (without follow to stop) and speed limiter, Rear fog lamps, Rear lights, Washer fluid level indicator, Without front fog lamps, Without headlamp washer system, Not hot country, 2-zone deluxe automatic air conditioning, Non-smoker version, Without auxiliary heater/parking heater, Digital instrument cluster, Bluetooth interface, Audi AG, Category 0, advanced, Standard-production quality, Driving on the right, Version (high), Type approval country Denmark, Part set without country-specific prescriptive standard, Wheels- 10-spoke turbine- 6.5J x 16- 195/55 R16 tires, Operating permit- alteration, 3-cylinder SI engine 1.0 l/81 kW TSI base engine is TJ4/TC5, No special edition, Without ECO function, Audi connect remote & control (for MMI radio plus), Regional code " ECE " for radio, No special purpose vehicle- standard equipment, Control of series production, Basic equipment variant, Production wheels, Country group A, Shock absorption in front, Manual transmission, Without antenna amplifier, Accent surfaces- Gloss Black, Tires 195/55 R16 91V xl, Top infotainment system Basic (MIB3), Without Audi connect navigation & infotainment, SI engine, Battery 380 A (59 Ah) EFB+, Sportsback, Without camera systems/accident sensors, Refrigerant R1234yf, Suspension range 01 installation control only- no requirement forecast, Left-hand drive, Delta cloth, Statutory emergency call, Adaptive cruise control, Standard seats- front, Without Storage package, LongLife Service Regime, Speech dialog system, Service indicator 30 000 km or 2 years ( variable ), Without aluminum look in the interior, With multifunction camera for NCAP requirements, Interior lighting, Without dynamic road sign display, Digital Audio Broadcasting, Electromechanical power steering, 3-cylinder SI engine 1.0 l unit 05C.A, Instrument cluster- km/h speedometer, Without hill hold assist, Smartphone interface, Tires without specification of tire brand, Standard pedal cluster, Extended and proactive pedestrian and cyclist protection, Equipment package for Denmark, Internal control code, Equipment options subset for Denmark

## PICTURES

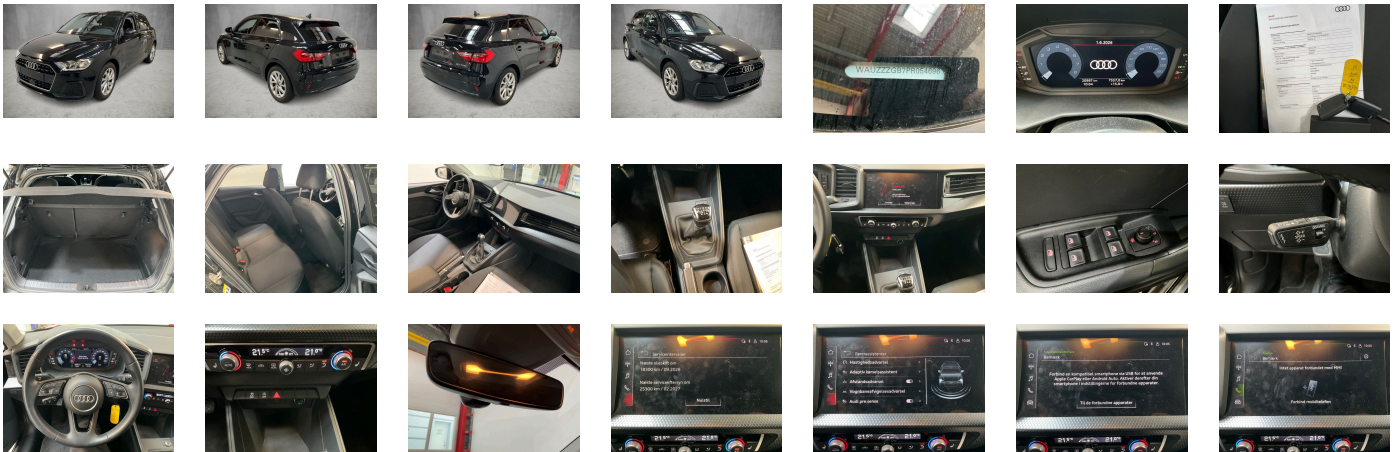

**Picture viewer:** <https://fm.bilsalg.dk/business/picturebrowser?t=full&guid=872e3153-f6cd-49ec-a7f4-3f49c2a03ced&carid=20476856>

## OVERVIEW OF DAMAGES AND SHORTAGES

| N° | LOCATION                                                                            | TYPE                                                                                | SEVERITY                                                                            | INSURANCE                                                                           | NOTES                                                                               | DAMAGE GROUP |
|----|-------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|--------------|
| 1  | L. Front Quarter Panel                                                              | Dent                                                                                | C4                                                                                  | Reporting needed                                                                    |                                                                                     | Group 1      |
|    |    |    |    |                                                                                     |                                                                                     |              |
| 2  | Front Bumper                                                                        | Scratch                                                                             | C4                                                                                  | Reporting needed                                                                    |                                                                                     | Group 1      |
|    |    |    |                                                                                     |                                                                                     |                                                                                     |              |
| 3  | Hood                                                                                | Dent                                                                                | C4                                                                                  | Reporting needed                                                                    |                                                                                     |              |
|    |    |    |    |    |    |              |
| 4  | Rear Bumper                                                                         | Scratch                                                                             | C4                                                                                  | Reporting needed                                                                    |                                                                                     | Group 2      |
|    |    |    |                                                                                     |                                                                                     |                                                                                     |              |
| 5  | R. Rear Quarter Panel                                                               | Scratch                                                                             | C4                                                                                  | Reporting needed                                                                    |                                                                                     | Group 2      |
|    |  |  |  |  |  |              |
| 6  | L. Rocker Panel                                                                     | Dent                                                                                | C4                                                                                  | Reporting needed                                                                    |                                                                                     |              |
|    |  |  |  |                                                                                     |                                                                                     |              |

Severity explanation:

C0 = No damage / C1 = Simple preparation / C2 = Minor preparation needed / C3 = Can be smart repaired / C4 = Repair/spray paint / C5 = Need replacement

## ELECTRICAL AND MECHANICAL CONDITION

| N° | LOCATION            | TYPE | NOTES |
|----|---------------------|------|-------|
| 1  | Is the car drivable | Yes  |       |